

SERVICE BULLETIN

BULLETIN NUMBER: SB-0046
REVISION: 1-0-0
DATE: DEC-2008

PRODUCT DESCRIPTION: CI-RC-4M Firmware Versions (for MT-4D & MT-4E)

DE REFERENCE / ECO: CO 6399

PRODUCTS AFFECTED: CI-4C-4M-00 & CI-RC-4M-01

SYMPTOMS: MT-4D transmitters are not changing channels or locking up and MT-4E transmitters are slow to respond.

CAUSE: With CTCSS or NAC-controlled RC-4M links, MT-4D radios required a delay before de-asserting PTTs to keep them from locking up during very short calls.

SOLUTION: When using MT-4D units with CI-RC-4M controllers, ensure that the RC-4M firmware is version 1.5. When operating with MT-4E units, ensure the RC-4M firmware is version 1.7 or higher for optimal speed and functionality.

PARTS REQUIRED: None

PROCEDURE: Return to Daniels Electronics Ltd. for firmware changes.

RETURN REQUESTS: To obtain an RMA number and shipping instructions, please contact the service department at 1-800-664-4066 or service@danelec.com.

Revision	Date	Description
1-0-0	Dec 2008	First Release